PRODUCT INFORMATION PACKET

Model No: G151381.60
Catalog No: G151381.60
Obsolete in the US,
aced by 199965.00 - .20HP..3530RPM.254JM.DP.230/460V.3PH.60HZ.CONT.40C.1.15SF.RIGID C.C254T34DK5.....

Nameplate Specifications

Phase	3	Output HP	20 & 15 Hp
Output KW	14.9 & 11.2 kW	Voltage	208-230/460 & 190/380 V
Speed	3542 & 2945 rpm	Service Factor	1.15 & 1.15
Frame	254JM	Enclosure	Drip Proof
Thermal Protection	No Protection	Efficiency	91 & 91 %
Ambient Temperature	40 °C	Frequency	60 & 50 Hz
Current	50-44/22 & 42/21 A	Power Factor	90
Duty	Continuous	Insulation Class	F
Design Code	B	KVA Code	G
Drive End Bearing Size	6309	Opp Drive End Bearing Size	6208
UL	Recognized	CSA	Y
CE	Y	IP Code	22
Number of Speeds	1		

Technical Specifications

Electrical Type	Squirrel Cage Inverter Rated	Starting Method	Wye Start Delta Run Or Inverter
Poles	2	Rotation	Reversible
Resistance Main	.139 Ohms	Mounting	Rigid Base
Motor Orientation	Horizontal	Drive End Bearing	Ball
Opp Drive End Bearing	Ball	Frame Material	Cast Iron
Shaft Type	JM	Assembly/Box Mounting	F2/F1 CAPABLE
Inverter Load	CONSTANT 2:1		
Outline Drawing	SS622304	Connection Drawing	004172.01

SS622304

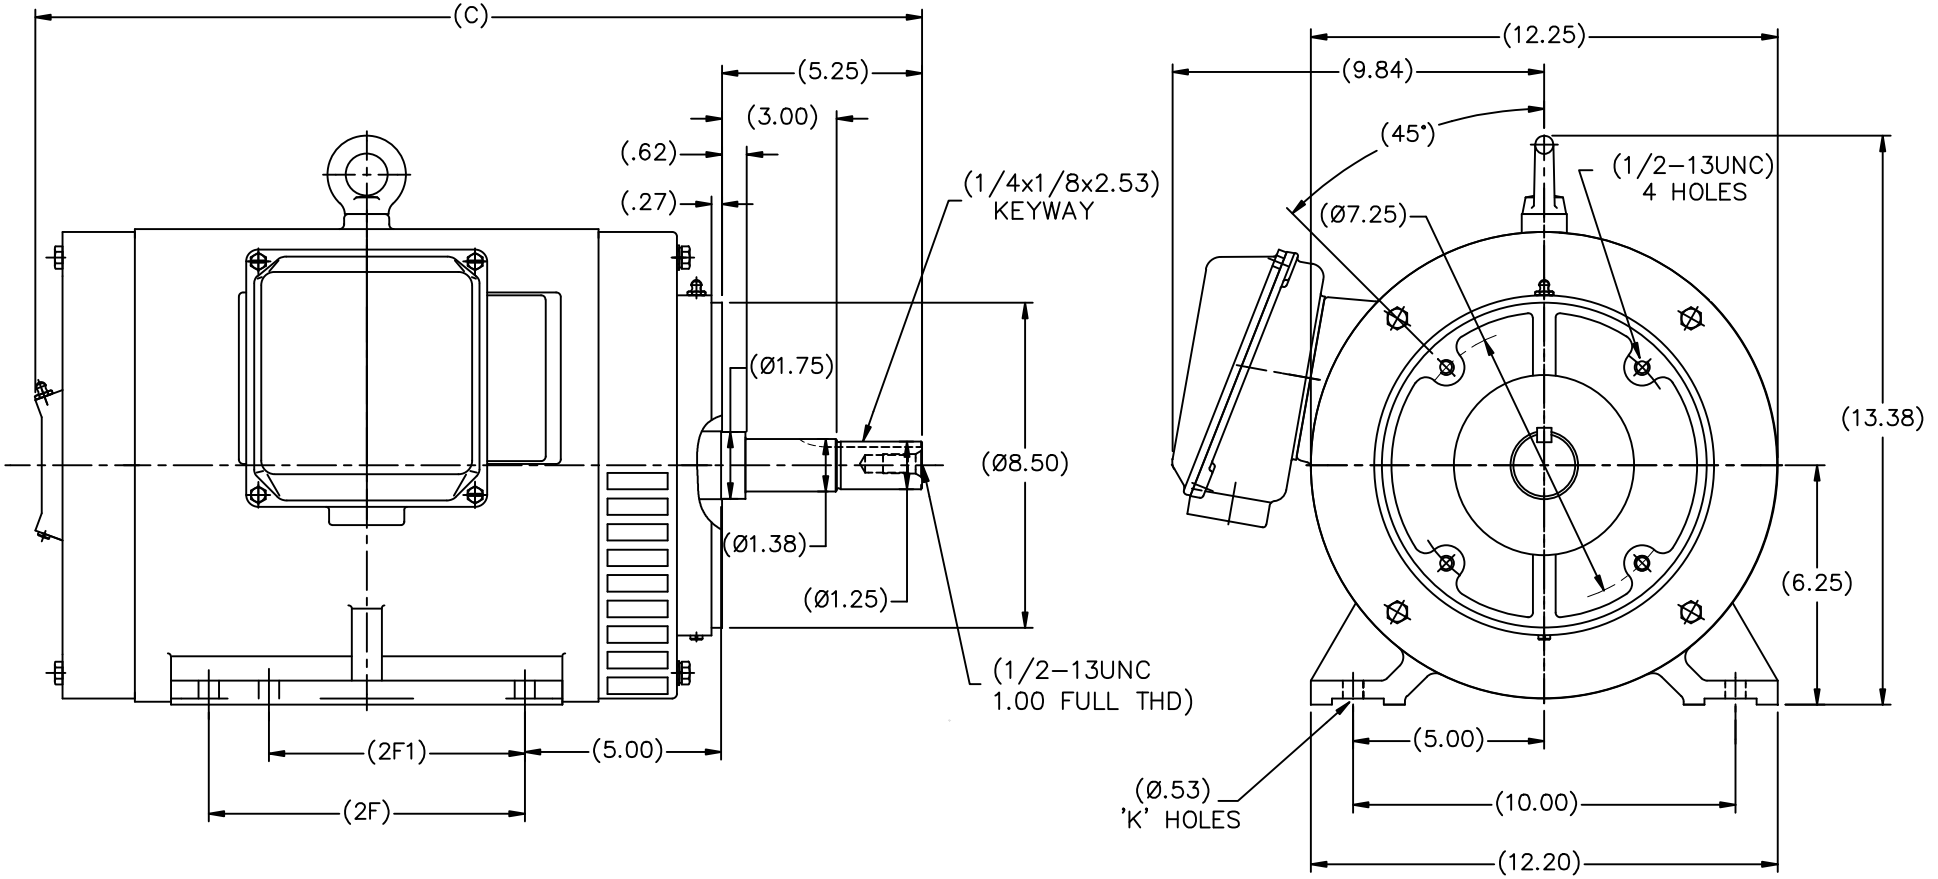

DRAWING NOT TO SCALE

CAT. NO.	TYPE	2F1	2F	K	C
G151381.60	N254		8.25	4	23.03
G151382.60	N256	8.25	10.00	6	24.75

NO.	REVISION	BY & DATE	CHK

TOLERANCES UNLESS SPECIFIED

DEC.	INCHES
.X	±.1
.XX	±.03
.XXX	±.005
.XXXX	±.0005
ANG	±7'30"

REGAL-BELOIT CORPORATION

DRAWN MOL 02–22–2011
CHK MOL 02–22–2011
APPD SB 02–22–2011
SCALE 1=3.7
REF
FMF
PREV

TITLE OUTLINE
250JM FR – C'FACE –ODP
MAT'L.
FINISH
CAD FILE SS622304
RFP
DIST

SIZE B | DRAWING NO. SS622304 | PAGE OF | REV.

WYE – DELTA STARTING USEABLE ON 2,4 AND 6 POLE MOTORS.

LOW VOLTAGE CONNECTION

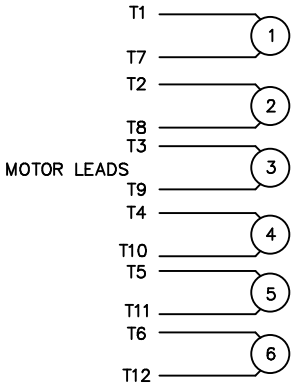

HIGH VOLTAGE CONNECTION

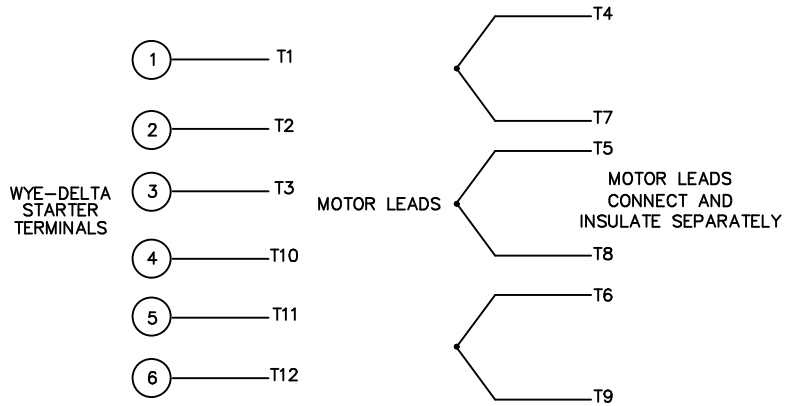

REFER TO THE WYE–DELTA STARTER CONNECTION INSTRUCTIONS FOR PROPER CONNECTION OF POWER LINES TO STARTER.

PART WINDING START USABLE ON 4 & 6 POLE MOTORS
LOW VOLTAGE CONNECTION ONLY

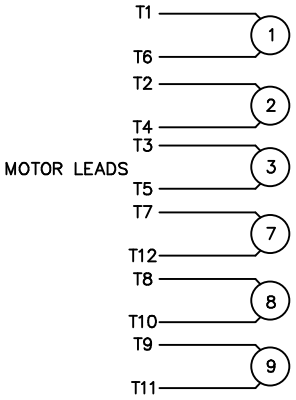

REFER TO THE PART WINDING STARTER INSTRUCTIONS FOR PROPER CONNECTION OF POWER LINES TO STARTER.

REFER TO THE CUTLER – HAMMER OR EQUIV. FOR PROPER SELECTION OF OVERLOAD HEATER COILS.

LINE LEADS

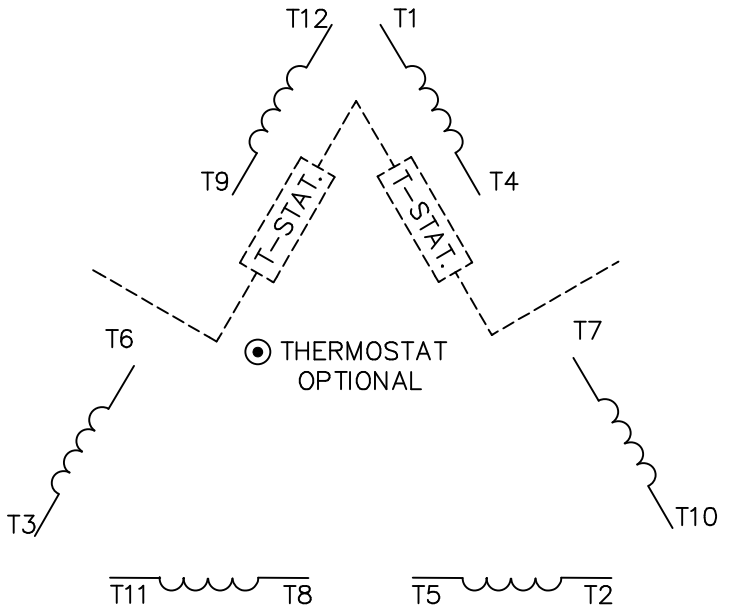

ROTATION CAN BE REVERSED BY INTERCHANGING ANY TWO LINE LEADS

⦿ RED LEADS OR P1, P2, FOR N/C THERMOSTAT

ACROSS THE LINE START & RUN

	LINE 1	LINE 2	LINE 3	JOIN & INSULATE SEPARATELY
HIGH VOLT	T1,T12	T2,T10	T3,T11	(T4,T7) (T5,T8) (T6,T9)
LOW VOLT	T1,T6 T7,T12	T2,T4 T8,T10	T3,T5 T9,T11	

NO.	REVISION	BY & DATE	CHK
03	REV'D LOW VOLTAGE CONN. LEADS PER ELEC.	BJB 06/07/00	
02	ADDED T–STAT. NOTES PER ELECTRICAL	KMM 06/02/98	
01	REDRAWN TO CAD	DBT 06/02/97	

TOLERANCES UNLESS SPECIFIED

DEC.	INCHES
.X	±.1
.XX	±.01
.XXX	±.005
.XXXX	±.0005
ANG	±1/2°

LEESON ELECTRIC MOTORS GEARMOTORS AND DRIVES

TITLE DELTA – WYE CONNECTION DIAGRAM

MAT'L.

FINISH

CAD FILE 00417201

RFP

DIST

DRAWN	WLW 09/08/77
CHK	RPB 09/12/77
APPD	JCW 09/12/77
SCALE	1=1
REF	
FMF	
PREV	

SIZE A | DRAWING NO. 004172–01 | REV. 03

6/28/2007 3:22:15 PM -