PRODUCT INFORMATION PACKET

Model No: G151754.60
Catalog No: G151754.60
Obsolete in the US,
aced by 194124.00 -.40HP..3550RPM.N286JP.TEFC.230/460V.3PH.60HZ.CONT.40C.1.15SF.RIGID.....PUMP.NOT...

Nameplate Specifications

Phase	3	Output HP	40 & 30 Hp
Output KW	30.0 & 22.4 kW	Voltage	208-230/460 & 190/380 V
Speed	3540 & 2950 rpm	Service Factor	1.15 & 1.15
Frame	286JP	Enclosure	Totally Enclosed Fan Cooled
Thermal Protection	No Protection	Efficiency	92.4 & 92.4 %
Ambient Temperature	40 °C	Frequency	60 & 50 Hz
Current	103-90/45 & 82/41 A	Power Factor	89
Duty	Continuous	Insulation Class	F
Design Code	B	KVA Code	G
Drive End Bearing Size	6311	Opp Drive End Bearing Size	6309
UL	Recognized	CSA	Y
CE	Y	IP Code	43
Number of Speeds	1		

Technical Specifications

Electrical Type	Squirrel Cage Inverter Rated	Starting Method	Wye Start Delta Run Or Inverter
Poles	2	Rotation	Reversible
Mounting	Rigid Base	Motor Orientation	Horizontal
Drive End Bearing	Ball	Opp Drive End Bearing	Ball
Frame Material	Cast Iron	Shaft Type	JP
Assembly/Box Mounting	F1/F2 CAPABLE	Inverter Load	CONSTANT 10:1
Outline Drawing	SS622325	Connection Drawing	00417201

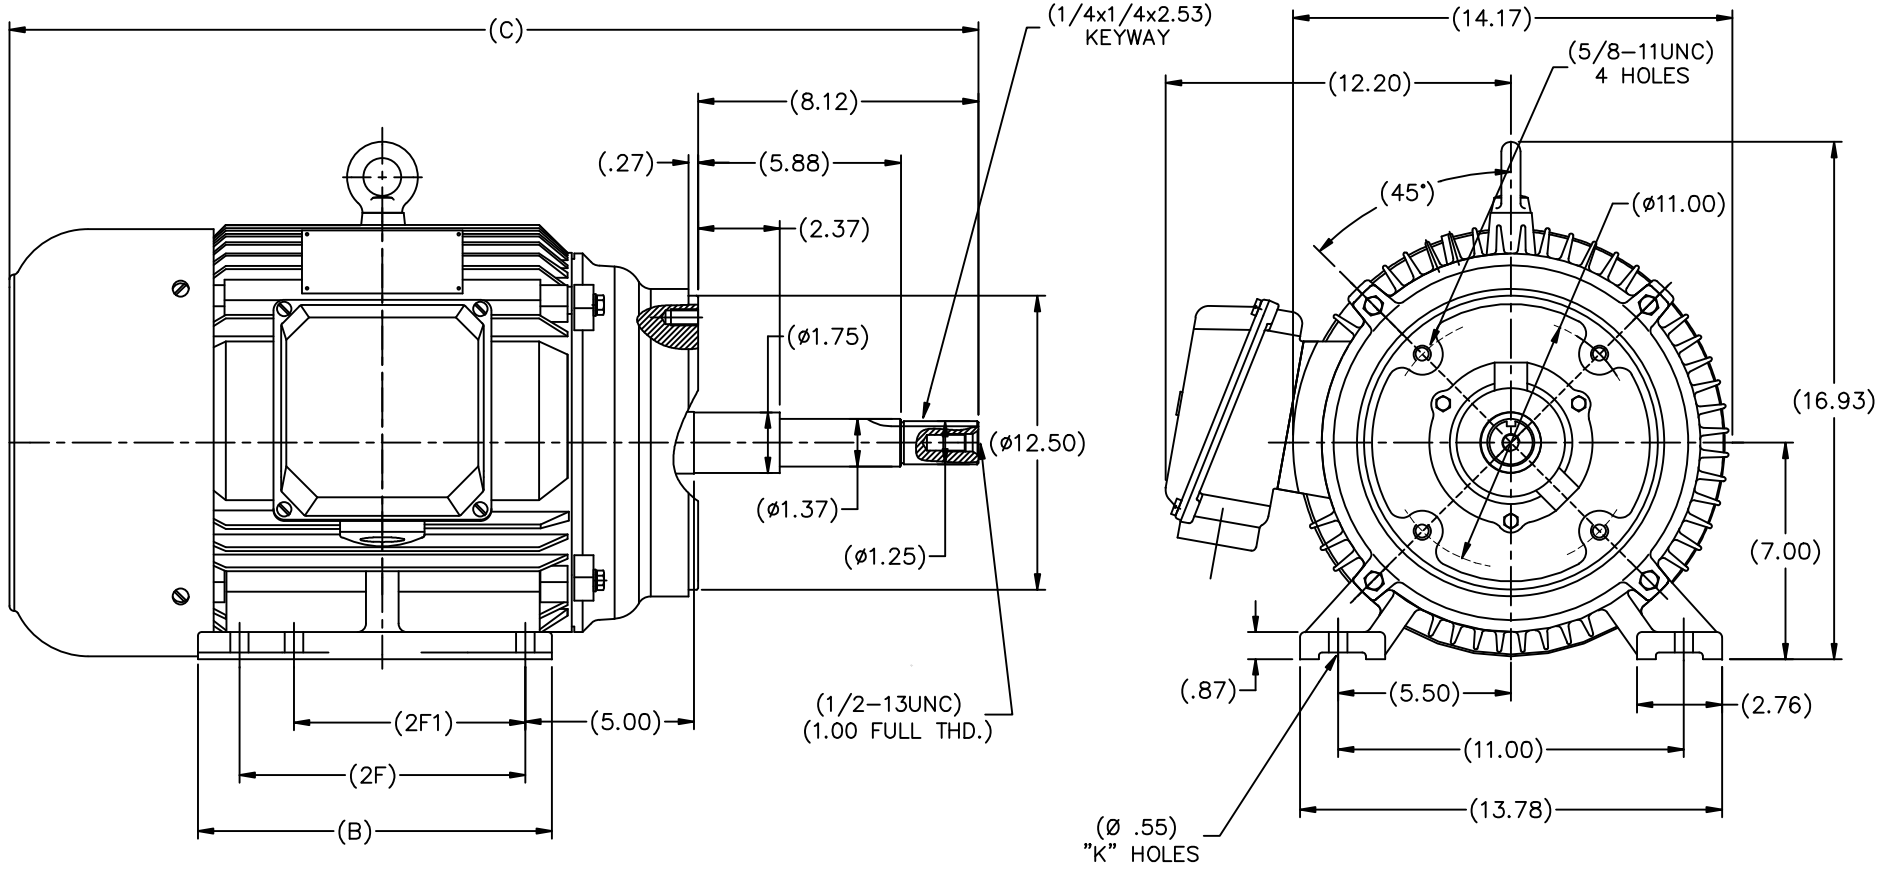

(DRAWING NOT TO SCALE)

TYPE	C	B	2F	2F1	K
N284JP	30.04	11.61	9.50	–	4
N286JP	31.61	13.11	11.00	9.50	6

NO.	REVISION	BY & DATE	CHK

TOLERANCES UNLESS SPECIFIED

DEC.	INCHES
.X	±.1
.XX	±.03
.XXX	±.005
.XXXX	±.0005
ANG	±7'30"

REGAL-BELOIT CORPORATION

DRAWN MOL 08–13–2011
CHK MOL 08–13–2011
APPD
SCALE 1=30
REF
FMF HEBEI
PREV

TITLE OUTLINE
N280JP –C FACE– TEFC

MAT'L.
FINISH
CAD FILE SS622325
RFP
DIST

SIZE B
DRAWING NO. SS622325
PAGE OF
REV.

004172-01

WYE – DELTA STARTING USEABLE ON 2,4 AND 6 POLE MOTORS.

LOW VOLTAGE CONNECTION

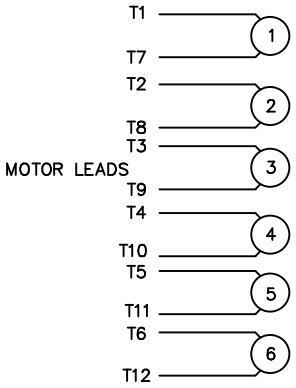

HIGH VOLTAGE CONNECTION

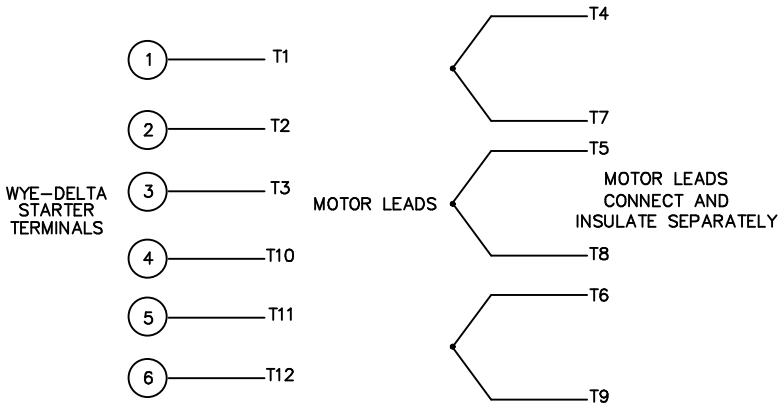

REFER TO THE WYE–DELTA STARTER CONNECTION INSTRUCTIONS FOR PROPER CONNECTION OF POWER LINES TO STARTER.

PART WINDING START USABLE ON 4 & 6 POLE MOTORS
LOW VOLTAGE CONNECTION ONLY

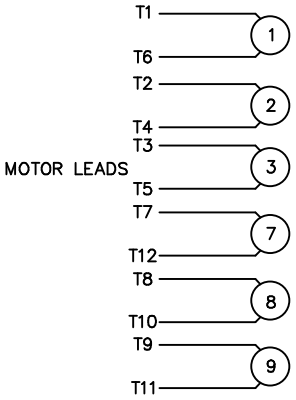

REFER TO THE PART WINDING STARTER INSTRUCTIONS FOR PROPER CONNECTION OF POWER LINES TO STARTER.

REFER TO THE CUTLER – HAMMER OR EQUIV. FOR PROPER SELECTION OF OVERLOAD HEATER COILS.

LINE LEADS

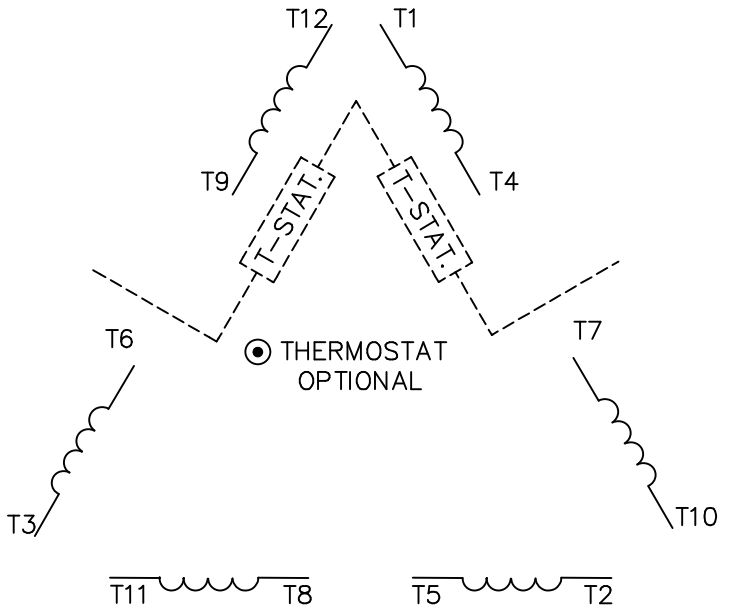

ROTATION CAN BE REVERSED BY INTERCHANGING ANY TWO LINE LEADS

⦿ RED LEADS OR P1, P2, FOR N/C THERMOSTAT

ACROSS THE LINE START & RUN

	LINE 1	LINE 2	LINE 3	JOIN & INSULATE SEPARATELY
HIGH VOLT	T1,T12	T2,T10	T3,T11	(T4,T7) (T5,T8) (T6,T9)
LOW VOLT	T1,T6 T7,T12	T2,T4 T8,T10	T3,T5 T9,T11	

NO.	REVISION	BY & DATE	CHK
03	REV'D LOW VOLTAGE CONN. LEADS PER ELEC.	BJB 06/07/00	
02	ADDED T–STAT. NOTES PER ELECTRICAL	KMM 06/02/98	
01	REDRAWN TO CAD	DBT 06/02/97	

TOLERANCES UNLESS SPECIFIED

DEC.	INCHES
.X	±.1
.XX	±.01
.XXX	±.005
.XXXX	±.0005
ANG	±1/2°

LEESON ELECTRIC MOTORS GEARMOTORS AND DRIVES

TITLE DELTA – WYE CONNECTION DIAGRAM

MAT'L.

FINISH

CAD FILE 00417201

RFP

DIST

DRAWN	WLW 09/08/77
CHK	RPB 09/12/77
APPD	JCW 09/12/77
SCALE	1=1
REF	
FMF	
PREV	

SIZE A | DRAWING NO. 004172–01 | REV. 03

6/28/2007 3:22:15 PM -