PRODUCT INFORMATION PACKET

Model No: 131988.00 Catalog No: 131988.00 7.50 HP General Purpose Motor, 3 phase, 3600 RPM, 230/460 V, 184T Frame, ODP General Purpose Motors



Regal and Leeson are trademarks of Regal Rexnord Corporation or one of its affiliated companies. ©2021 Regal Rexnord Corporation, All Rights Reserved. MC017097E





Product Information Packet: Model No: 131988.00, Catalog No:131988.00 7.50 HP General Purpose Motor, 3 phase, 3600 RPM, 230/460 V, 184T Frame, ODP

LEESON


Nameplate Specifications


Output HP	7.50 Hp	Output KW	5.6 kW
Frequency	60 Hz	Voltage	230/460 V
Current	17.6/8.8 A	Speed	3515 rpm
Service Factor	1.15	Phase	3
Efficiency	88.5 %	Power Factor	90
Duty	Continuous	Insulation Class	F
Design Code	Α	KVA Code	L
Frame	184T	Enclosure	Drip Proof
Thermal Protection	Automatic	Ambient Temperature	40 °C
Drive End Bearing Size	6206	Opp Drive End Bearing Size	6205
UL	Recognized	CSA	Y
CE	Y	IP Code	22
Number of Speeds	1		

Technical Specifications

Electrical Type	Squirrel Cage Induction Run	Starting Method	Across The Line
Poles	2	Rotation	Reversible
Resistance Main	1.4 Ohms	Mounting	Rigid Base
Motor Orientation	Horizontal	Drive End Bearing	Ball
Opp Drive End Bearing	Ball	Frame Material	Rolled Steel
Shaft Type	т	Overall Length	16.19 in
Frame Length	12.00 in	Shaft Diameter	1.125 in
Shaft Extension	2.75 in	Assembly/Box Mounting	F1 Only
Outline Drawing	035464-1200	Connection Drawing	005010.20

This is an uncontrolled document once printed or downloaded and is subject to change without notice. Date Created:10/07/2021

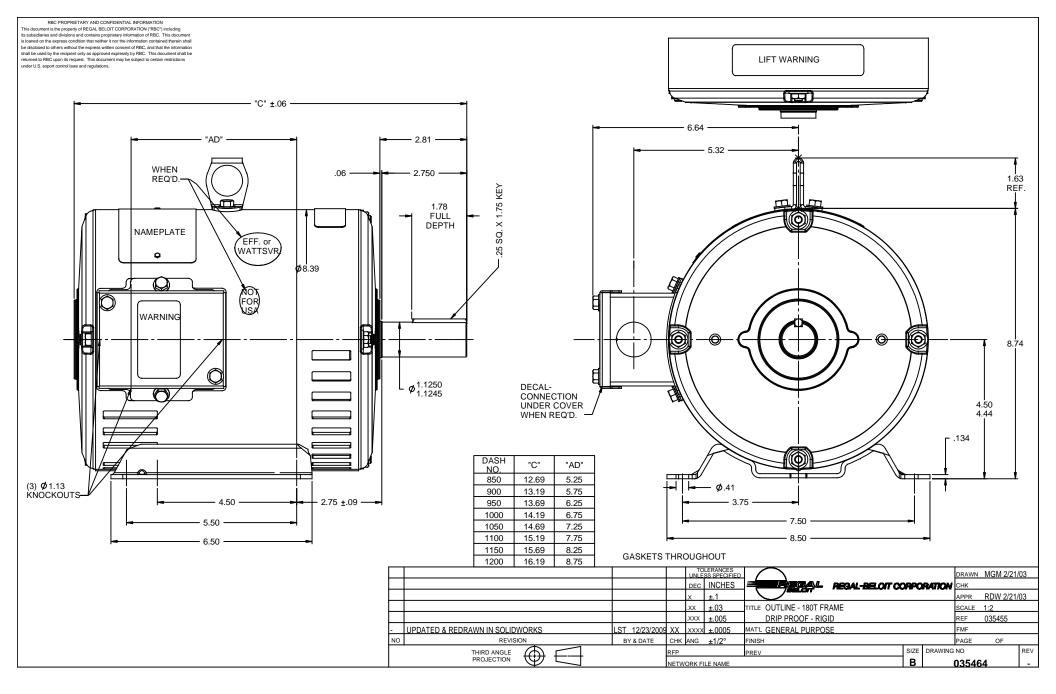

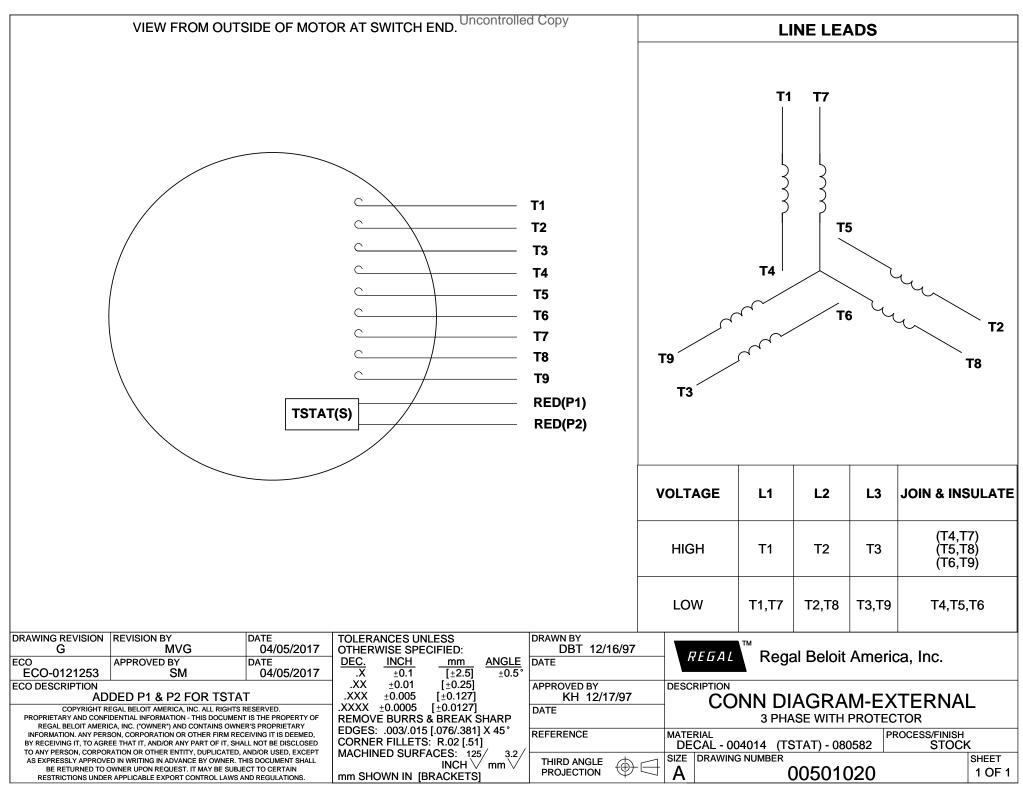

Uncontrolled Copy

Date:	1/29/	/2018		Data S	heet			131988	00	
Dute.		2010			SON					
				Moto	r Load Data	R		C	Data @ 460) V
oad	0%	25%	50%	75%	100%	115%	125%	LR		
urrent (Amps)	2.79	3.5	4.9	6.8	8.8	10.0	11.0	80.0		
rque (ft-lb)	0.00	2.75	5.6	8.4	11.3	13.0	14.1	33.9		
PM	3600	3578	3555	3530	3502	3,486	3474	0		
ficiency (%) F. (%)	9.3	84.4 59.6	89.5 79.6	89.6 86.9	88.5 90.0	88.1 91.1	87.2 91.5	0.0		
		Motor Speed Da				•				
	LR	Pull-Up	BD	Rated	Idle					
eed (RPM)	0	650	2800	3502	3600			nformation Block		
rrent (Amps)	80.0	73.6	48.0	8.8	2.79	HP		7.5		
que (ft-lb)	33.9	30.0	41.6	11.3	0.00	Sync. RPM		3600		
	-			•		Frame		180		
E	fficiency (%)	— P.F. (%)	— C	Current (Amps)		Enclosure		DP		
100.0					<u> </u>	Construction		TDW		
						Voltage		230/460	V	
						Frequency		60	Hz	
90.0				1	10.0	Design		A		
					10.0	LR Code letter		J		
	-					Service Factor		1.15		
80.0						Temp Rise @ I	FL	15	°C	
					8.0 A M	Duty		CONT		
70.0					P	Ambient		40	°C	
					S	Elevation		1,000	feet	
					6.0	Rotor/Shaft wk	2	0.56	Lb-Ft ²	
60.0						Ref Wdg		T8293 DR		
						Sound Pressur	e @1M	0	dBA	
					4.0	VFD Rating		NONE	=	
50.0										
						Outline Dwg			464-1200	
40.0					2.0	Conn. Diag Additional Spec	oifications:	00	5010.20	
40.0							sincations.			
					_					
						0				
30.0					0.0	0		V CKT (OHMS / PHAS		
30.0	40%	60% 80%	100%	120% 1	0.0 40%	0 R1	R2	X1	X2	
	40%	60% 80% LOAD	100%	120% 1		0 R1 0.0000				
	40%		100%			0.0000	R2	X1	X2	
	40%		100%	Speed -	40%	0.0000	R2	X1	X2	
	40%			Speed -	40%	0.0000 urve	R2	X1	X2	00 0.0
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	0.000	00 0.0
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	0.000	.0
45.0	40%			Speed -	40%	0.0000 urve	R2	X1	90	.0
45.0	40%			Speed -	40%	0.0000 urve	R2	X1	90	.0
45.0	40%			Speed -	40%	0.0000 urve	R2	X1	90 80	.0
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	90 90 80 70	.0 0.0
45.0	40%			Speed -	40%	0.0000 urve	R2	X1	90 80	.0
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	90 90 80 70 60	.0 .0 .0 .0
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	90 90 80 70	.0 .0 .0 .0 .0 .0 .0
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	90 90 80 70 60 50	.0 .0 .0 .0 .0 P
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	90 90 80 70 60	.0 .0 .0 .0 .0 P
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	90 90 80 70 60 50	.0 .0 .0 .0 .0 P
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	90 90 80 70 60 50	.0 .0 .0 .0 .0 .0 .0 .0 .0 .0 .0 .0 .0
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	90 90 80 70 60 50 40	.0 .0 .0 .0 .0 .0 .0 .0 .0 .0 .0 .0 .0
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	90 90 80 70 60 50 40 30	.0 .0 .0 .0 .0 .0 .0 S .0
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	90 90 80 70 60 50 40	.0 .0 .0 .0 .0 .0 .0 S .0
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	X2 0.000 90 80 70 60 50 40 30 20	0 0.0 .0 .0 .0 .0 .0 .0 .0 .0 .0
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	90 90 80 70 60 50 40 30	0 0.0 .0 .0 .0 .0 .0 .0 .0 .0 .0
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	X2 0.000 90 80 70 60 50 40 30 20 10	.0 .0 .0 .0 .0 .0 .0 .0 .0 .0
0% 20%	40%			Speed -	40%	0.0000 urve	R2	X1	X2 0.000 90 80 70 60 50 40 30 20	.0 .0 .0 .0 .0 .0 .0 .0 .0 .0